

# PUBLIC LAND SURVEY MONUMENT RECORD


For Public Land Survey Corners in the  
T. 4 N., R. 10 E.

## CORNER CODE INDEX

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25
A																									
B																									
C	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	
D																									
E																									
F																									
G	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	
H																									
I																									
J																									
K																									
L	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	
M																									
N																									
O																									
P	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	
Q																									
R																									
S																									
T	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	
U																									
V																									
W																									
X																									
Y	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	
Z																									

PLACE MONUMENT SYMBOL (◆) AT PROPER LOCATION ON ABOVE INDEX

### EXAMPLE

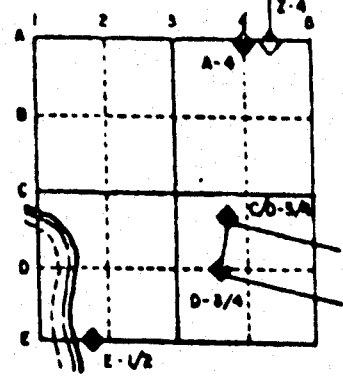

UNION TWP  
ROCK COUNTY WI

### IF AVAILABLE STATE PLANE COORDINATES

North (Y) \_\_\_\_\_ Elev. (Z) \_\_\_\_\_  
 East (X) \_\_\_\_\_ Zone \_\_\_\_\_  
 Hor. Datum \_\_\_\_\_ Vert. Datum \_\_\_\_\_

◆ CORNER MONUMENT

○ WITNESS MONUMENT

BEARINGS ARE BASED ON:



(B) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1900 BROWN VOL 2 PG 518 SET IRON 1317.52' FROM THE S 1/4 & SW CORNERS OF SECTION 32. USED TO SUBDIVIDE SW 1/4 OF SEC 32.

1968 BATTERMAN JR. VOL 4 PG 365 FOUND LIMESTONE 1 1/2' DEEP & REFERENCED SAME.

FOUND SE REFERENCE PIPE BUT COULD NOT FIND THE NE & NW REFERENCE PIPES. FOUND PATCH AND LIMITS OF OLD EXCAVATION CLEARLY DELINEATED. DUG 2' DIAMETER HOLE 2.5' DEEP AT CENTER OF PAVEMENT AND RECORD DISTANCE TO REFERENCE PIPE. FOUND NOTHING.

C) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

SINCE THE LIMESTONE WAS NOT FOUND AT THE NEW EXCAVATION OF THE N 1/4 CORNER OF SECTION 5, I DID NOT DIG FOR THE LIMESTONE. ESTABLISHED THE CORNER AT RECORD DISTANCE FROM THE REFERENCE PIPE AND MAINTAINED HARMONY WITH RECORD TIE CALLS TO FENCES AT OLD REFERENCE PIPES.

D) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (a), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 4 of the witness monuments shown on the drawing in (a), above.

(E) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning the corner location.

NO

I, Donald Barnes, hereby certify that the corner points as identified by the corner code index were, in a field survey on, June 22, 1994, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with the regulations and rules as required in the current manual of survey instructions of the United States Department of Interior, Bureau of Land Management.

seal

*Donald Barnes*  
June 23, 1994

AFFIX YOUR LAND SURVEYOR SEAL

COUNTY SURVEYOR FILING DATA

Date of computer entry \_\_\_\_\_

Date microfilmed \_\_\_\_\_

Number of included sheets 3  
CORNER CODE

26(1)

