

PUBLIC LAND SURVEY MONUMENT RECORD

For Public Land Survey Corners in the


T. A N., R. 10 E.

CORNER CODE INDEX

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25
A																									
B																									
C																									
D																									
E																									
F																									
G																									
H																									
I																									
J																									
K																									
L																									
M																									
N																									
O																									
P																									
Q																									
R																									
S																									
T																									
U																									
V																									
W																									
X																									
Y																									
Z																									

PLACE MONUMENT SYMBOL (◈) AT PROPER LOCATION ON ABOVE INDEX

EXAMPLE

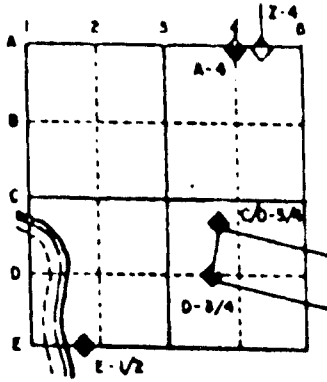

UNION TWP
ROCK COUNTY WI

IF AVAILABLE
STATE PLANE COORDINATES

North (Y) _____ Elev. (Z) _____
 East (X) _____ Zone _____
 Hor. Datum _____ Vert. Datum _____

◈ CORNER MONUMENT

○ WITNESS MONUMENT

BEARINGS ARE BASED ON:

UN620 E 1/4 36

(B) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1867 LOCKE VOL 1 PG 301 FOUND REMAINS OF B TREES- SET OAK STAKE WITH HARDHEAD ON N,S,E, & W IN **EDGE OF DITCH**. 2650.56' VAR 7-55 TO SE & 2647.92' VAR 7-40 TO NE CORNERS OF SECTION 36. 2637.03' TO CENTER OF SECTION 36.

1870 RUGER REMONUMENTATION NOTES. NORTH ON EAST LINE OF SE 1/4 SEC 36 ON A VAR 7-21 OFFSET WEST 8 LKS (5.28') AT 40.19 CHS (2652.54') INTERSECTED QUARTER LINE 1 LK (.66') WEST OF QUARTER COR. FOUND STAKE SURROUNDED BY HARD HEAD STONES SET BY LOCKE AT CORNER. ALSO FOUND REMAINS OF STUMPS OF BEARING TREES COR VAR 7-28.

NORTH ON EAST LINE OF NE 1/4 SEC 36 ON A VAR 7-12 OFFSET EAST 13 LKS (8.58') AT 40.18 CH (2651.88') INTERSECTED NORTH BOUNDARY LINE 12 LKS EAST OF CORNER. COR VAR 7-11. (PLACED CUT LIMESTONE)

1874 RUGER VOL 2 PG 165 FOUND STONE MONUMENT. SET STAKE SURROUNDED WITH 3 HH AT W 1/4 CORNER OF SECTION 31 PORTER TWP WHICH IS 11.22' NORTH OF E 1/4 CORNER OF SECTION 36 UNION TWP. W 1/4 COR OF SEC 31 IS MIDWAY BETWEEN THE NW & SW CORNERS OF SECTION 31 PORTER TWP. W 1/4 COR IS 2599.41' TO CENTER OF SECTION 31 & 5253.27' TO E 1/4 CORNER OF SEC 31 PORTER TWP.

DUG VERY LARGE HOLE 3' DEEP WITH BACKHOE AND FOUND NOTHING. DUG BY HAND AT THE W 1/4 CORNER OF SEC 31 PORTER TWP AND FOUND 3 PIECES OF 1"X4" CUT LIMESTONE SCATTERED AROUND THE CENTER OF THE HOLE AS SHOWN IN THE DRAWING. FOUND LARGE WOOD POST 15" DEEP AND REMAINS OF OLD BARB WIRE. PLACED G-1 MONUMENT IN CENTER OF POST.

C) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

RESTORED CORNER THROUGH ACCEPTANCE OF OBLITERATED EVIDENCE LOCATION. PLACED ALUMINUM MONUMENT 15" DEEP ON LINE WITH THE W 1/4 CORNER OF SECTION 31 PORTER TWP AND THE SE CORNER OF SECTION 36 UNION TWP AT RUGER'S 1874 RECORD DISTANCE OF 11.22'. THE DIFFERENCES IN VARIANCE IN BEARINGS BETWEEN THE NE CORNER TO THE E 1/4 CORNER AND THE E 1/4 CORNER TO THE SE CORNERS OF SECTION 36 ARE:

LOCKE 0-15'
RUGER 0-17'
NEW BEARINGS 0-17'

(E) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning the corner location.

NO

I, Donald Barnes, hereby certify that the corner points as identified by the corner code index were, in a field survey on, SEP 8, 1994, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with the regulations and rules as required in the current manual of survey instructions of the United States Department of Interior, Bureau of Land Management.

COUNTY SURVEYOR FILING DATA

Date of computer entry _____


Date microfilmed _____

Number of included sheets _____
CORNER CODE


seal
Donald Barnes
Sep 12, 1994





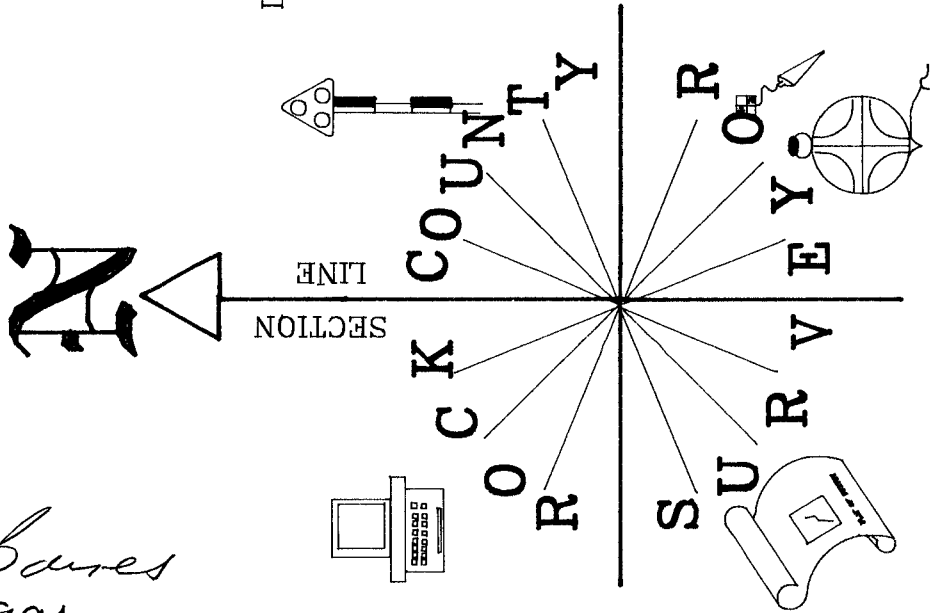


AFFIX YOUR LAND SURVEYOR SEAL

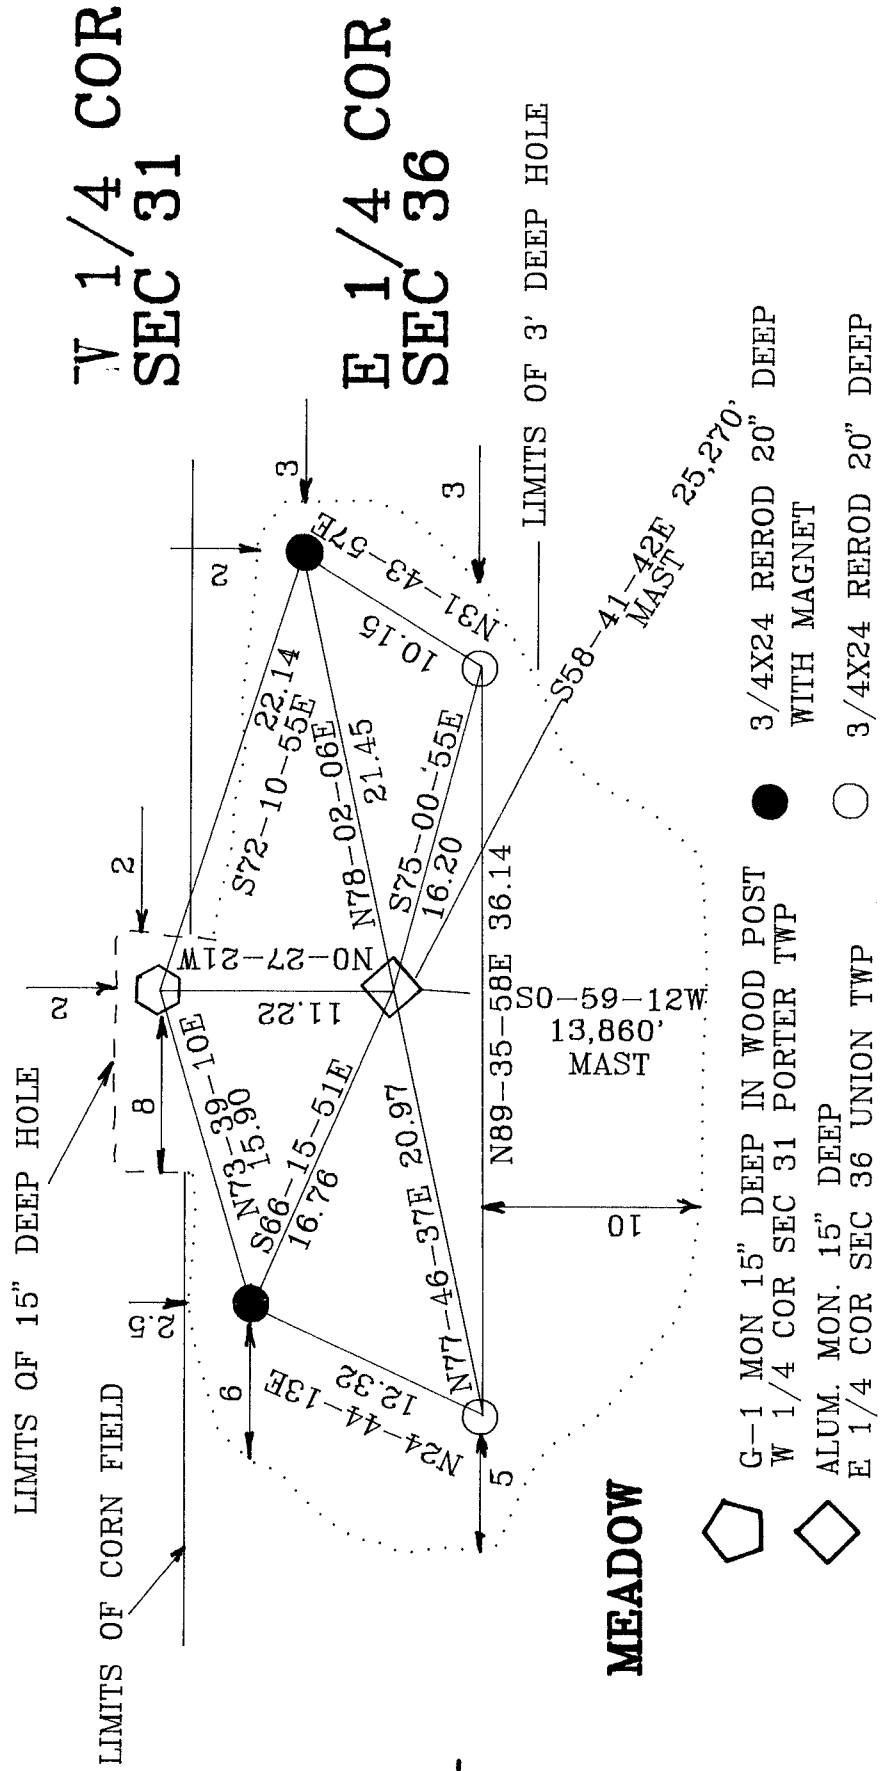Donald Barnes
Sep 12, 1994



CORN FIELD



-  G-1 MON 15" DEEP IN WOOD POST
-  W 1/4 COR SEC 31 PORTER TWP
-  3/4X24 REROD 20" DEEP WITH MAGNET
-  3/4X24 REROD 20" DEEP
-  ALUM. MON. 15" DEEP
-  E 1/4 COR SEC 36 UNION TWP
-  3/4X24 REROD 20" DEEP

X 25


PLAT AND RECORD

Survey on Section **6** T **3** N. R. **10** E. of the 4 P. M. in **CENTER UNION MAGNOLIA** Township
 County, Wisconsin, made **SEPTEMBER** the **19** th **1994**

I hereby certify that the following is a correct record of said survey as made by me.

County Surveyor.

LOCKE PRO 2618.27 S89-47-28E 2619.51 LOCKE 1867 2612.29 VAR 7-00 RUGER 1870 2619.54 VAR 6-39 BARNES 1980 2619.50 ORIG 2602.05	LOCKE PRO 2618.27 S89-46-10E 2618.53 LOCKE 1867 2612.29 VAR 7-00 RUGER 1870 2619.54 VAR 6-39 BARNES 1980 2618.53 ORIG 2602.05	RUGER 1874 16.5 LOCKE 1867 16.5
NO-0456W 2650.48 RUGER 1870 2652.54 VAR 6-58 BARNES 1980 2650.47 ORIG 2640	LOCKE PRO 2652.66 NO-12-30W 2652.27 LOCKE 1867 2648.60 VAR 7-35	LOCKE PRO 2653.98 SO-09-48E 2653.02 LOCKE 1867 2647.92 VAR 7-40 RUGER 1870 2651.88 VAR 7-11 RUGER 1874 2660.79 (W 1/4 - NW SEC 31) SO-10W 2658.33 FD POST SO-29-09W 11.22 RUGER 1874 11.22
SO-11-04E 2655.13 RUGER 1870 2653.2 VAR 6-45 BARNES 1980 2654.94 ORIG 2640	LOCKE PRO 2611.32 S89-45-10E 2616.46 LOCKE 1867 2605.35 VAR 7-00	LOCKE PRO 2658.63 SO-28-25E 2656.84 LOCKE 1867 2650.56 VAR 7-55 RUGER 1870 2652.54 VAR 7-28 RUGER 1874 2660.79 (SW - W 1/4 SEC 31) SO-25W 2667.85 NO-N89-11-07E 2604.99 NRUGER 1874 2548.92 VAR 7-25
LOCKE PRO 2626.99 S89-36-51E 2626.51 BARNES 1980 2626.51 RUGER 1870 2626.8 VAR 6-39 LOCKE 1867 2620.99 VAR 6-55	LOCKE PRO 2627.19 RUGER 1870 2625.15 VAR 6-16 LOCKE 1867 2621.19 VAR 6-55 S89-51-41E 2627.19	KERCH 2596.1 BROWN 1900 2614.92 ORIG 2587.20
NO-35-09E 2276.66 BARNES 1980 2276.65 ORIG 2254.58	CHURCH 1855 2491.50 ORIG PLAT 0' ORIG FIELD NOTES 0' NO-27-12W 2562.24 ORIG FIELD NOTES 2640 TO TEMP. POST CHURCH 1855 2529.12 ORIG PLAT 2560.8 1320 ORIG PLAT 1240.8 ORIGINAL SHOULD BE 2521.2 (2640-118.8)	1320 ORIG PLAT 1018.38 BROWN 1900 2337.72 RUGER 1878 2333.43 ORIG PLAT 2338.38 NO-27-22W 2339.82
FD ALUM. NO-14-48E 2658.65 BARNES 1980 2658.61 1325 BARNES 1979 1330	CHURCH 1855 2648.43 NO-20-20W 2648.94 CHURCH 1855 2647.92 VAR 4 S86-39-18E 2653.11 INSTALLED POLY INT 1/4 LINES 2645.02	FD DRAG TOOTH & BRICKS NO-25-23W 222.42 ORIG PLAT 2560.8 ORIG PLAT 2338.36 222.42 NO-25-22W 2639.17 BROWN 1900 2640 RUGER 1878 2635.05 ORIG PLAT 2640 RUGER 1878 2578.29 ORIG 2565.42 BROWN 1900 2586.54 KERCH 2585.5
FD ALUM. BARNES 1980 2657.12 ORIG 2635.38 S86-52-22E 2656.75	BARNES 1980 2657.13 ORIG 2635.38 S86-52-22E 2656.75	FD ALUM. FD STAKE & BRICKS NO-31-38W 222.27 ORIG PLAT 222.42' KERCH 222.42 ORIG FIELD NOTES 222.42'

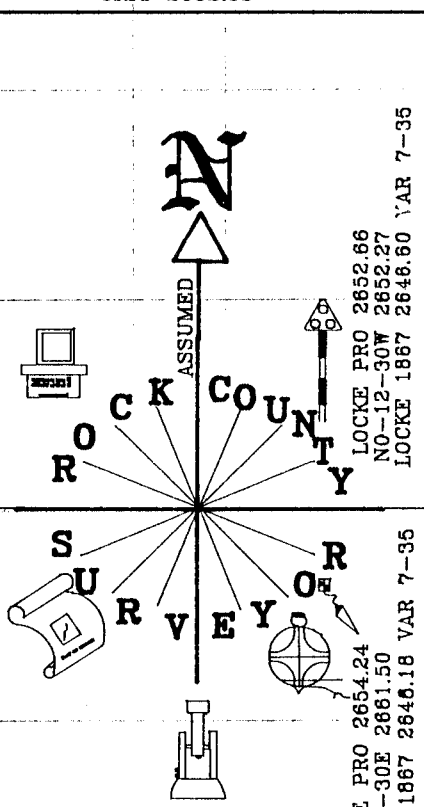

SEC 36

SEC 31

SEC 1

SEC 6

COMPUTED PER WI LAWS
 ON LINE WITH 1/4 CORNERS
 & AT EQUAL DISTANCE

BARNES 1980 93-22-23
 93-24-45

BARNES 1980 180-00-00
 180-0-0